

**TO:** ALL AUTHORIZED SERVICE ACCOUNTS  
AS-1975 MANUAL OWNERS

**SUBJECT:** CHRYSLER DOUBLE BITTED SIDEBAR IGNITIONS

**NO:** AS-1160  
**DATE:** 4-24-98  
**FILE IN:** BULLETIN BINDER

In 1998 Chrysler introduced 3 new **8 cut** Ignition Lock Cylinders which uses Lock Service Packages, 703718 (PTL), 703719 (Module), 703545 (B Van). These three Ignitions use new tumblers for Chrysler.


Tumblers 322691, 322692, 322693, 322694 with Spring 46970 are used with Lock Service Packages 703718 and 703719.

Tumblers 322521, 322522, 322524, 322534 with Spring 56028 are used with Lock Service Package 703545. **Do not** use the new GM 10 cut tumblers in this vehicle.

It is important to use only the sidebar tumblers in these locks. Make sure you do not use the door/deck lock tumblers in these locks. They will fit the lock but will create a defective lock. The defects you may see are: the lock will rotate once or more and then will not rotate at all, or you can pull the key out in the run position and may not be able to turn to the accessory position.




322691

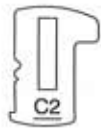

322692




322693

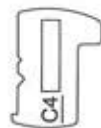


322694



46970

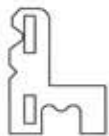


322521

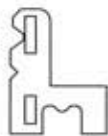

322522



322523

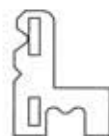

322524



56028