

TO: ALL AUTHORIZED SERVICE ACCOUNTS
AS-1975 MANUAL OWNERS


SUBJECT: 1998 LH I/P LOCK CYLINDER

NO: AS-1161

DATE: 4-24-98

FILE IN: BULLETIN BINDER

Due to a latch problem, for the first 3 months of the 1998 model year the I/P locks were installed in the factory without the fourth tumbler ward being loaded. If the tumbler was present, the lock would not rotate properly. The latch was redesigned and corrected. If you repair a 1998 LH I/P lock and find the tumbler missing do not load that tumbler ward as you will create a glove box latch/lock problem.

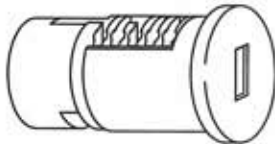

597245