SERVICE



BULLETIN

TO CENTRAL SERVICE DISTRIBUTORS AUTHORIZED AUTOMOTIVE SERVICE DISTRIBUTORS AS-1975 MANUAL OWNERS No. AS-1106

DATE 12/16/88

FILE IN Bulletin
Binder


SUBJECT POSSIBILITY OF PREMATURE DEPLOYMENT OF SIR MODUAL DURING SERVICE OF SAGINAW AIR BAG STEERING COLUMN








CAUTION: Disconnect battery. Disconnect coil assembly at base of steering column <u>BEFORE</u> servicing ignition lock to avoid SIR modual from deploying prematurely causing bodily harm. Place restraint modual on flat surface with air bag facing <u>UP</u> to avoid premature inflation and bodily harm.

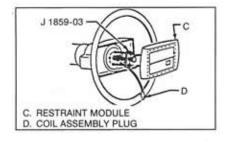

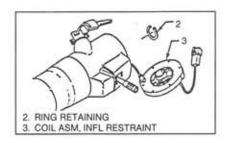

SERVICE NOTICE:

Wheels should be straight and key in lock position when removing coil. Re-installing coil off center position will cause ribbon in coil assembly to break. As always, secure all fasteners before applying torque to ensure proper function of steering column.

BRIGGS & STRATTON TECHNOLOGIES

Scot Hooper Service Manager