

SERVICE BULLETIN

BRIGGS & STRATTON TECHNOLOGIES


Automotive Systems Group

TO CENTRAL SERVICE DISTRIBUTORS
AUTHORIZED AUTOMOTIVE SERVICE DISTRIBUTORS
AS-1975 MANUAL OWNERS



SUBJECT GENERAL MOTORS GLOVE COMPT. LOCKS

No. AS-1092
DATE 12-15-85
FILE IN

LOCK CYLINDERS REAR END VIEW

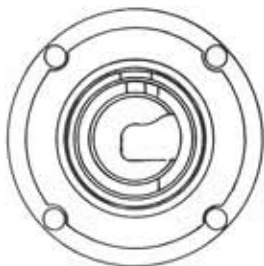

A

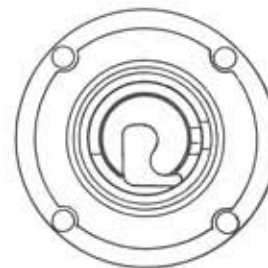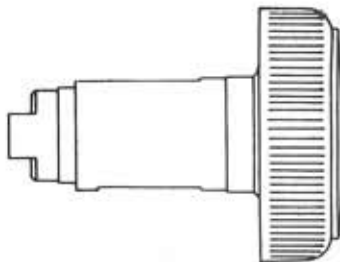

B

Since 1978 part 607850 has been used in certain Glove applications. A common complaint has been difficulty in rotating cylinder in that case housing.

Our AS-1975 Service Manual addresses that problem in plate # 95 with a recommendation to alleviate the condition.

Example A is the cylinder currently used with 607850 Case & Bolt Assembly.

Example B is the new design cylinder used with 609720 Case & Bolt for 1986.

CAUTION: Style A cylinders can only be used with 607850.

Style B cylinders can only be used with 609720.

As our current inventory of style A cylinders are depleted we will be replacing with the style B cylinders. Therefore, when servicing 1985 and early models with the style B cylinders you will have to replace the Case & Bolt Assembly also, using 609720.

BRIGGS & STRATTON CORPORATION

L.B. White
Service Sales Manager
Automotive Lock Div.

LBW: bjo