


SERVICE BULLETIN

TO:	AS-1975 MANUAL OWNERS/AWLD DIST	NO.	AS-1301
SUBJECT:	706770 IGNITION	DATE:	9/22/06
		FILE IN:	BULLETIN BINDER

It has been reported to Strattec that a large number of Chevrolet Cobalt's are coming in with ignition problems. The cause appears to be the new ignition locks that have a plastic plug. The ignition lock just stops turning even though the proper key is used. Strattec is not the OE manufacturer of these ignitions.

The OE replacement ignitions come completely unassembled and the assembly requires the lock face to be staked at four locations around the circumference. The sidebar, sidebar actuator springs and sidebar holder tabs must also be installed and staked into position in the outer plug housing.

Strattec has an ignition lock (part #706770) that can be used as an alternative to the dealer only ignitions. Strattec ignition lock cylinders have a solid, all-zinc cylinder and the tumblers are supported by zinc tumbler wards instead of plastic housings. These locks have sidebars preassembled. All a locksmith must do is code the locks with tumblers and springs.

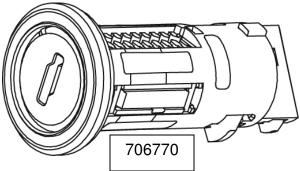

The Strattec 706770 ignition can be used as an alternative to dealer only ignitions. The chart below identifies which vehicles can accept the 706770.

Model	Make	Years	OE	GM lgn #	SSC#	Key	Key Description	Pinning Kit
				•				•
Chevrolet	Cobalt	06-07	Ortech	22720859	706770	692931	93 Grv, Circle +	707842, Kit #1
	Equinox	2007	Huf/Ortech	22720859	706770	692931	93 Grv, Circle +	707842, Kit #1
	HHR	06-07	Ortech	22720859	706770	692931	93 Grv, Circle +	707842, Kit #1
Pontiac	Pursuit	06-07	Ortech	22720859	706770	693121	93 Grv, Circle +	707842, Kit #1
	Solstice	06-07	Ortech	22720859	706770	693121	93 Grv, Circle +	707842, Kit #1
	Torrent	2007	Huf/Ortech	22720859	706770	693121	93 Grv, Circle +	707842, Kit #1
Saturn	Sky	2007	Ortech	22720859	706770	693127	93 Grv, Circle +	707842, Kit #1
Suzuki	XL-7	2007	Huf/Ortech	22720859	706770	692361	93 Grv, Circle +	707842, Kit #1
							93Grv, non-	
Saturn	lon	03-07	SSC	22720859	706770	599487	trans	707842, Kit #1

Please contact your local Strattec distributor for this ignition.